



National Inspection Services
: **117003** on 02/01/2015
VIN: **4V2JCBPE7SR837610** Unit: **T1905**

VOCON Marcus Bowersox
4747 NE 14th St Des Moines, IA 50313 USA
(515) 299-6265

1994 VOLVO WG64T

WG64T Specifications

Engine Hours	4924
Engine	Cummins M11 280 HP
Fuel	Diesel 1 Alum Tanks 65 Gal. Total
Transmission	Rockwell Manual RM9-125A 9 Spd
Axles	Tandem 12,000 Front / 40,000 Rear
Frame Type	Single
Suspension	Air / Spring
Wheelbase	192"
Tire Size F	11R22.5
Tire Size R	11R22.5
Wheels	Steel
Air Cond	No * Not Operational
Interior Color	BLACK
Hi Back Seats	Driver Side Only
Exterior Color	RED
Bumper	Painted
Heated Mirrors	No
Visor	No

Drive Options


Inspection Photos



Power Steering

Notes / Description

1994 Volvo tandem axle road truck converted to a yard dog for jockeying trailers, drop and hook. Unit has hydraulic mechanism mounted to frame. Truck is in poor condition and operates with a broken primary frame of lift.

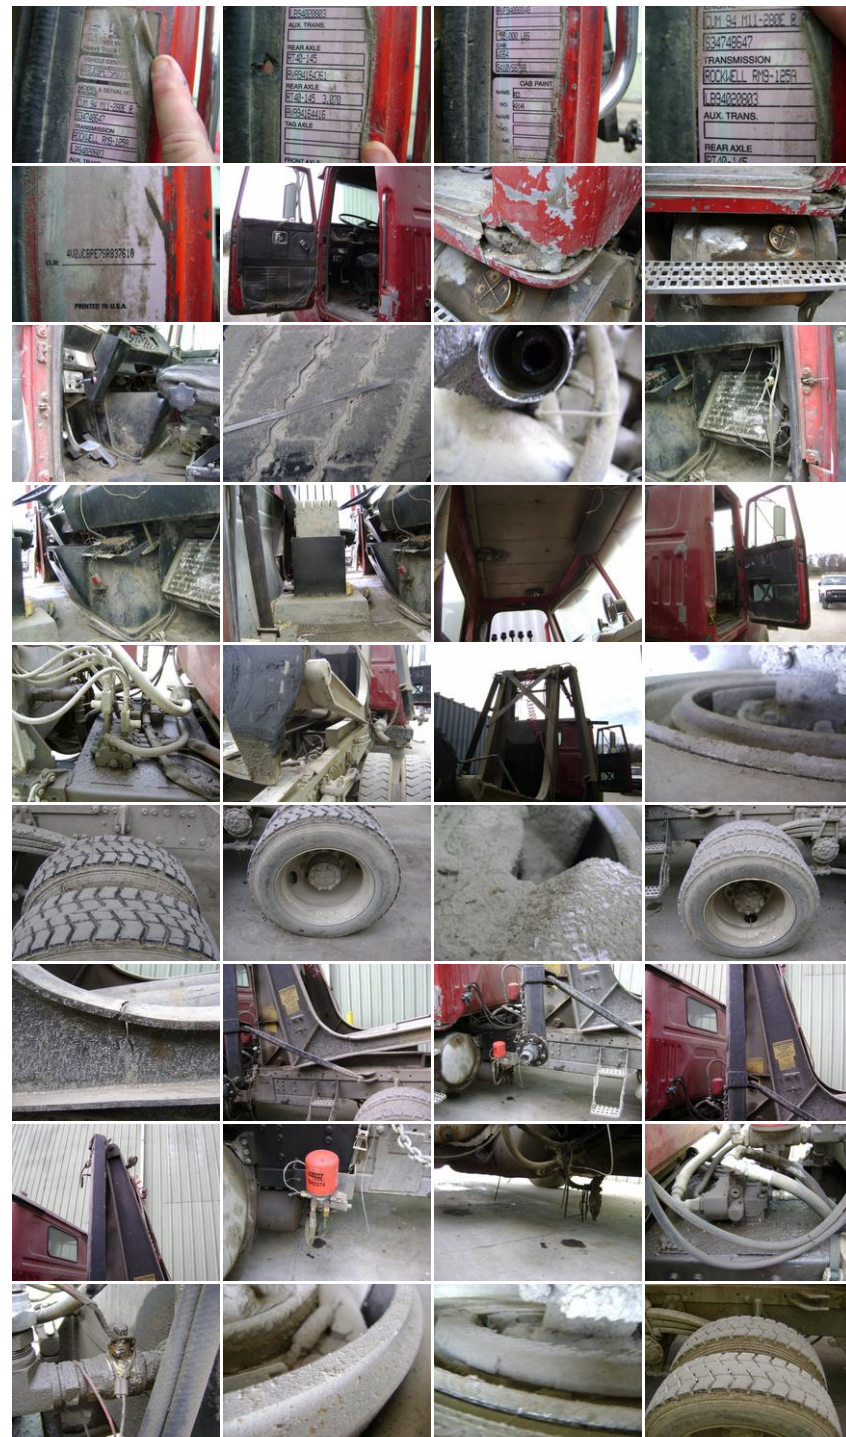





National Inspection Services

: 117003 on 02/01/2015

VIN: 4V2JCBPE7SR837610 Unit: T1905

VOCON Marcus Bowersox

4747 NE 14th St Des Moines, IA 50313 USA

(515) 299-6265

1994 VOLVO WG64T

Brakes	
16	16
16	16
16	15
Additional Brake Detail	
Deep grooved drums, mud caked slack adjusters, air leaks stem to stern	

Tires			
Front 11R22.5	Yokohama 9 / 32 Steel	Yokohama 8 / 32 Steel	Rear 11R22.5
19 / 32 Steel	18 / 32 Steel	17 / 32 Steel	17 / 32
12 / 32 Steel	13 / 32 Steel	13 / 32 Steel	16 / 32 Steel
Additional Tire Detail			
Regular front...Very HD rear caps			

General Observations	
Oil Milky? No Oil Leaks? Yes Water Leaks? No Oil in Coolant? No Clutch Play? Needs Attention Starts? Yes Drives? Yes	
Safety / Operational Observations	
Lights Work? See Detail Wipers Work? Yes Gauges Work? See Detail City Horn Works? No Air Horn Works? No	
Additional Observation Detail	
Questionable accuracy on most gauges...some are no longer working, they are primarily heat monitors for rear axles and transmission. The cab is very dirty and shows neglect. Some knobs are missing and some are not identified for there use. Air	

leaks and oil leaks...nothing major but very apparent.Low oil pressure and dipstick is Blued.

Wear and Tear Items		
Lights	Head lights and load lamps are the primary lighting everything else is nonilluminating	NA
Frame	Trailer lift frame is broken	NA
Windshield	RS windshield is broken	NA
Body	Hood and body are damaged...Significant	NA
Engine	Compression low...20 lbs at idle and 33 Lbs at full throttle. Lots of Blow By	NA
Electrical	Wires hanging under dash, and stem to stern @ frame	NA
Shift Stick	Loose...Hi-Lo is missing..Unit runs in Hi side only	NA
Odometer	Does not work	NA
Engine	Check engine light is on, oil leaks @ engine and transmission	NA
Power Steering	Leaks...Severe	NA
Hydraulic	Hyd. Station leaks	NA
Air Leaks	In Dash, Under truck stem to stern	NA
Lights	Headlights and load lamps Only	NA
Total Estimate		NA

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© 2015 National Inspection Services (NIS)
6501 E. Commerce Ave. Suite 135 Kansas City, MO 64120
www.nationalinspect.com