



National Inspection Services
: **127889** on 03/24/2016
VIN: **5V CDC6BEX7H20406** Unit: **3296**

Housby Auctions Marcus Bowersox
4747 NE 14th St Des Moines, IA 50313 USA
(515) 299-6265

2006 AUTOCAR WX64 GARBAGE PACKER

WX64 GARBAGE PACKER Specifications	
Mileage	339,238 / 340,477 ECM
Engine Hours	23645
Engine	Cummins ISM 10.8L 320 HP
Engine Serial	35167730
Fuel	Diesel 1 Alum Tanks 100 Gal. Total
Transmission	Allison Auto 4500 RDS 6 Spd
Axles	Tri 18,000 Front / 46,000 Rear
Frame Type	Steel
Suspension	Walking Beam
Tire Size F	315/80R22.5
Tire Size R	315/80R22.5
Wheels	Steel
Exterior	96"W 21'L
Air Cond	Yes * Not Operational
Interior Color	GREY
Radio Config	AM/FM/CD * Operational
Hi Back Seats	Driver Side Only
Pass Seat	Stationary
Exterior Color	BLUE
Bumper	Painted
Heated Mirrors	Yes
Visor	No


Drive Options

Overdrive, Cruise Control, Power Steering

Notes / Description

Inspection Photos



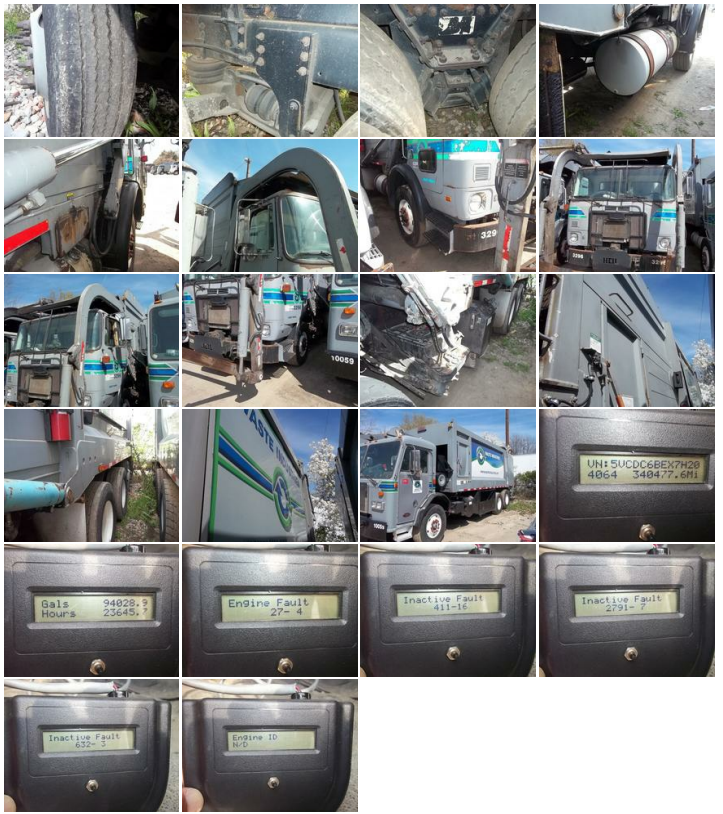



National Inspection Services
 # : 127889 on 03/24/2016
 VIN: 5VCDC6BEX7H20406 Unit: 3296

Housby Auctions Marcus Bowersox
 4747 NE 14th St Des Moines, IA 50313 USA
 (515) 299-6265

2006 AUTOCAR WX64 GARBAGE PACKER

Brakes	
9	13
Additional Brake Detail	
Rear brake linings were inaccessible for measurement.	

Tires			
Front 315/80R22.5	Michelin 10 / 32 Steel	Michelin 11 / 32 Steel	Rear 315/80R22.5
Michelin 13 / 32 Steel	Michelin 12 / 32 Steel	Goodyear 4 / 32 Steel	Continental 6 / 32 Steel
Michelin 10 / 32 Steel	Michelin 10 / 32 Steel	Michelin 10 / 32 Steel	Michelin 13 / 32 Steel
Goodyear 13 / 32 Steel			Kelly 6 / 32 Steel
Additional Tire Detail			

General Observations	
Oil Milky? No	Oil Leaks? No
Water Leaks? No	Oil in Coolant? No
Clutch Play? NA	Starts? Yes
Drives? Yes	
Safety / Operational Observations	
Lights Work? Yes - All	Wipers Work? Yes
Gauges Work? NA	City Horn Works? Yes
Air Horn Works? NA	
Additional Observation Detail	
PTO system was not functional. Interior PTO control panel was loose and needs repair. Engine Scan: Engine Fault- 27-4; Inactive Fault-411-16; Inactive Fault-2791-7; Inactive Fault-632-3. Leaking oil behind turbo and at pan.	

Wear and Tear Items		
Exterior Cab	Many areas with large chips, scratches, peeling, and faded paint for cab exterior.	NA
Interior Cab	Interior cab components were dirty with heavy wear.	NA
Brakes	Front left shoes measure below 50%	NA
Tires	3 measure below terms	NA
ICC bumper	Rear bumper bent	NA
A/C	Not blowing cold air	NA
Total Estimate		NA

Condition report only. National Inspection Services does not guarantee mechanical reliability.

