



National Inspection Services
: **137808** on 03/27/2017
VIN: **1FVXTMCB1YHB91233** Unit: **413**

Housby Auctions Marcus Bowersox
4747 NE 14th St Des Moines, IA 50313 USA
(515) 299-6265

2000 FREIGHTLINER FL112

FL112 Specifications	
Mileage	579,944
Engine Hours	20084
Engine	Cummins ISM 330 HP
Engine Brake	Yes
Engine Serial	34980751
Fuel	Diesel 1 Alum Tank 100 Gal. Total
Transmission	Eaton Manual 8LL Spd
Rear	Meritor 4.30
Axles	5 18,000 Front / 23,000 Rear
GVW (lbs)	64,000
Frame Type	Steel
Suspension	Walking Beam
Wheelbase	264"
Tire Size F	425/65R22.5
Tire Size R	11R22.5
Wheels	Aluminum
A/C	Yes * Operational
Interior Color	GRAY
Radio Config	AM/FM/CASS * Operational
Hi Back Seats	Dual
Pass Seat	Stationary
Exterior Color	GREEN
Bumper	Chrome
Heated Mirrors	Yes
External Visor	Yes


Drive Options
Overdrive, Power Steering

Inspection Photos





Notes / Description

--



2000 FREIGHTLINER FL112 PHOTOS

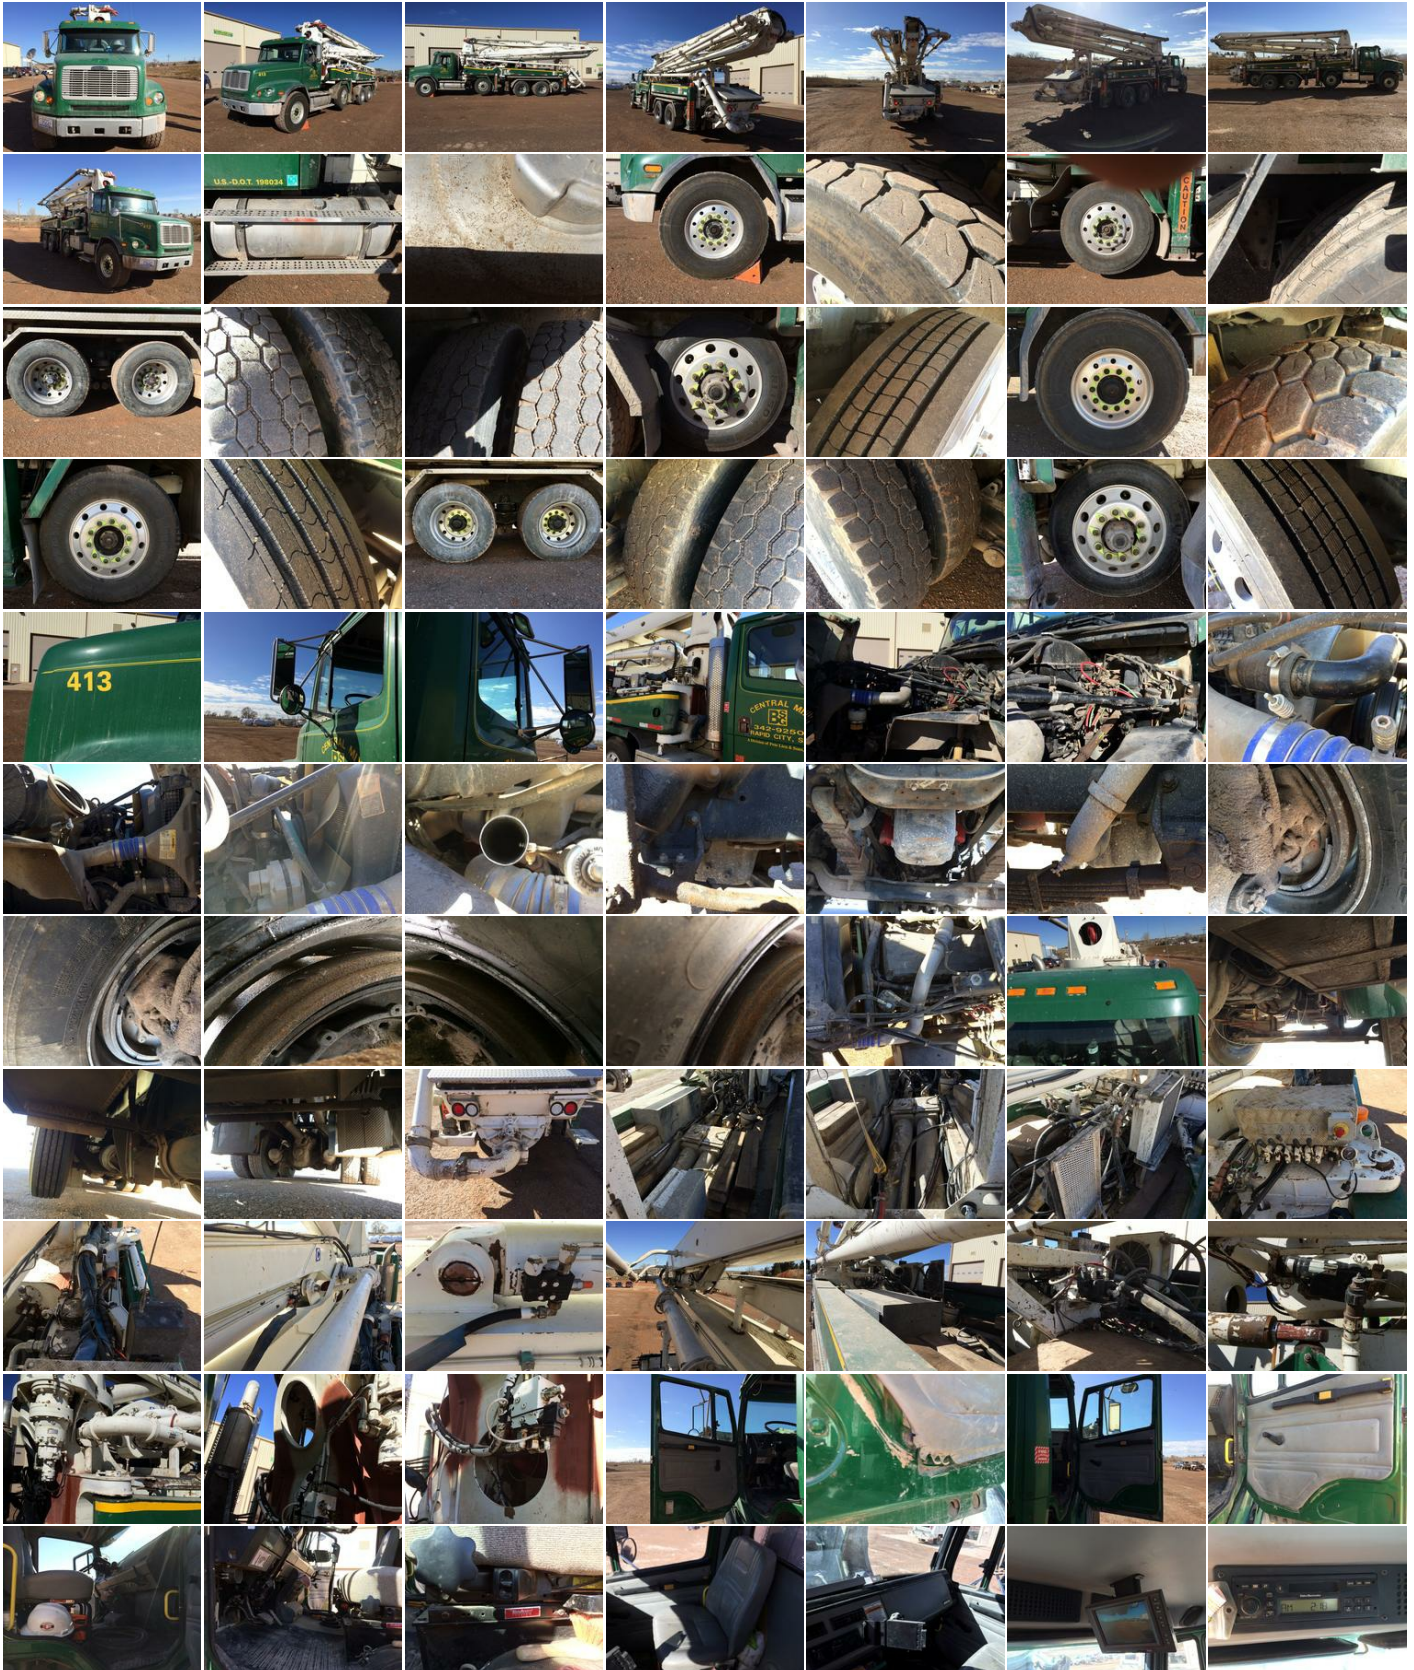

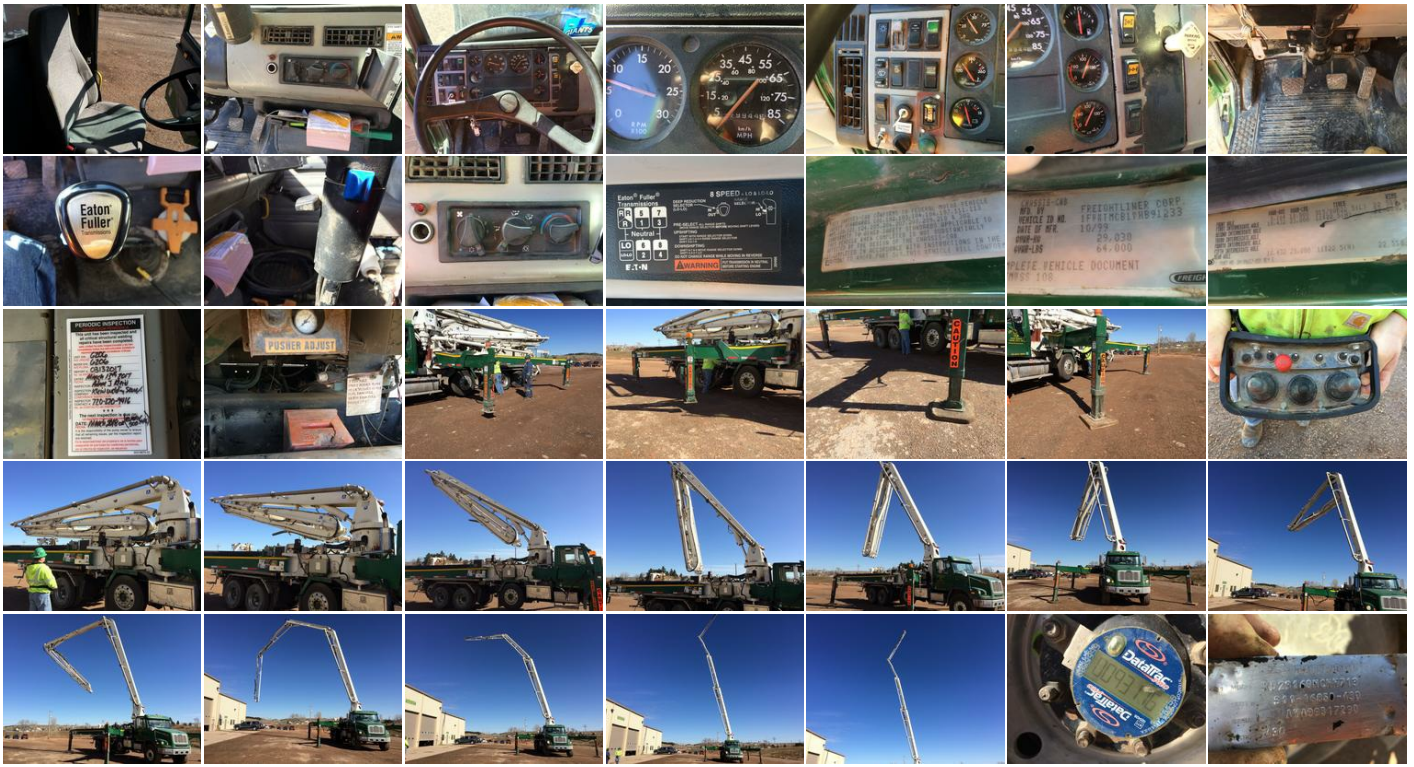



National Inspection Services
: 137808 on 03/27/2017
VIN: 1FVXTMCB1YHB91233 Unit: 413

Housby Auctions Marcus Bowersox
4747 NE 14th St Des Moines, IA 50313 USA
(515) 299-6265

2000 FREIGHTLINER FL112

Brakes	
27	28
20	21
26	27
Additional Brake Detail	

Tires			
Front 425/65R22.5	Bridgestone 14 / 32 Aluminum	Bridgestone 15 / 32 Aluminum	Rear 11R22.5
Michelin 16 / 32 Aluminum			Michelin 16 / 32 Aluminum
Bridgestone 11 / 32 Aluminum			Bridgestone 12 / 32 Aluminum
Bridgestone 13 / 32 Aluminum	Bridgestone 12 / 32 Aluminum	Bridgestone 11 / 32 Aluminum	Bridgestone 12 / 32 Aluminum
Bridgestone 11 / 32 Aluminum	Bridgestone 9 / 32 Aluminum	Bridgestone 10 / 32 Aluminum	Bridgestone 10 / 32 Aluminum
Falken 19 / 32 Aluminum			Falken 13 / 32 Aluminum
Additional Tire Detail			
Front tag axle 315/R8022.5, Rear Tag axle 255/70R22.5			

General Observations	
Oil Milky? No	Oil Leaks? Yes
Water Leaks? No	Oil in Coolant? No
Clutch Play? Ok	Starts? Yes
Drives? Yes	
Safety / Operational Observations	
Lights Work? Yes - All	Wipers Work? Yes
Gauges Work? Yes - All	City Horn Works? Yes
Air Horn Works? Yes	
Additional Observation Detail	
Seepage at rear seal.	

Wear and Tear Items		
Driver Door	Interior door panel damaged at lower edge	NA
Fenders	Small cracks in diamond plate fender, 1 each side	NA
Tires	1 below terms	NA
Seats	Small hole in drivers seat, both soiled	NA
Bumper	Slightly misaligned	NA
Paint	Various chips and scratches	NA

Total Estimate		NA
----------------	--	----

Condition report only. National Inspection Services does not guarantee mechanical reliability.

© 2017 National Inspection Services (NIS)
6501 E. Commerce Ave. Suite 135 Kansas City, MO 64120
www.nationalinspect.com